Troubleshooting i30 Cruise Control part no. E9600 2L020

Fault describtion
Cruise control dosnt work after quick on/off ignition key (less than 15 sec between).

Reason
Cruise control make internal shutdown and must be reset. This is normal by having ignition ***off***, more than 15 sec.

Solution
Move current power line from brake curcuit onto +15 fuseline.

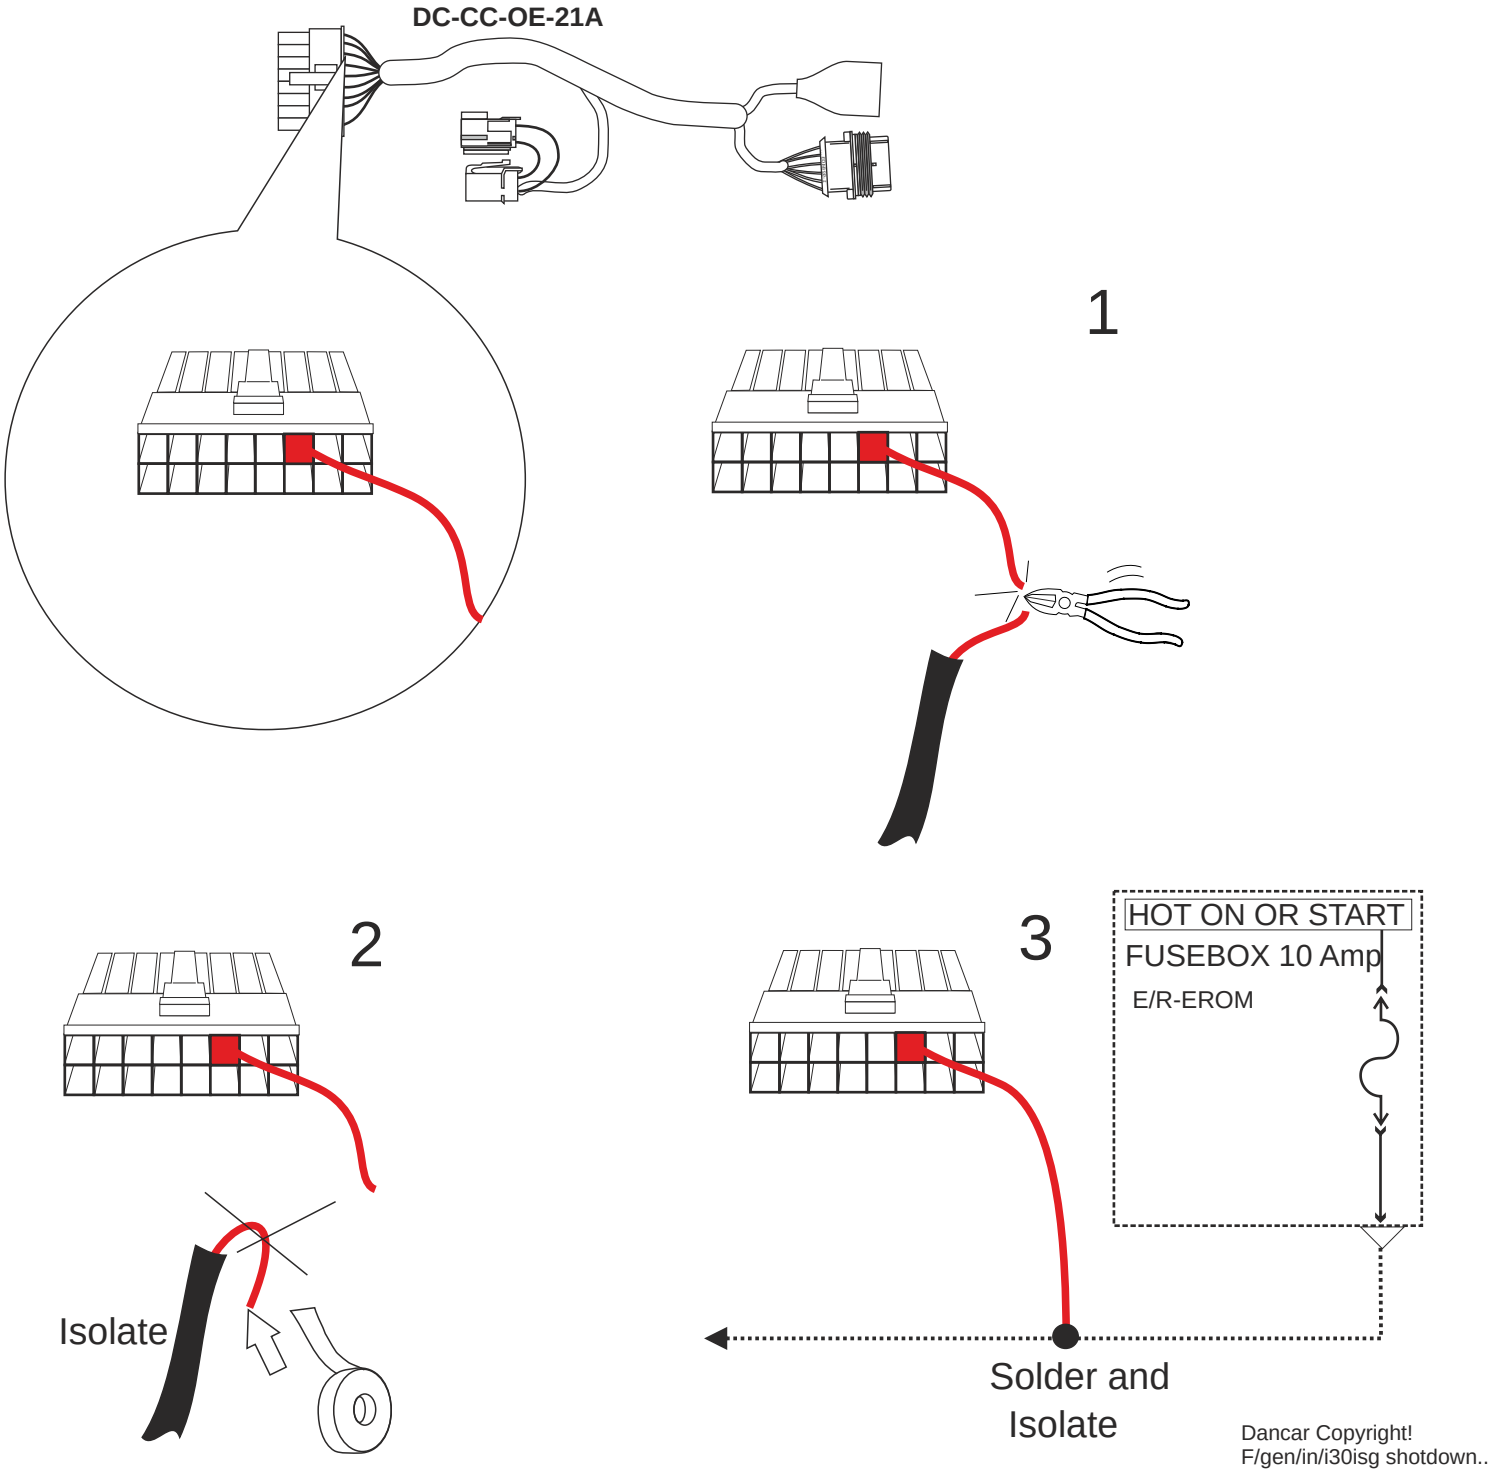

Dancar Copyright!
F/gen/in/i30isg shotdown..